

[Download / Print Document](#)

## Reference number(s): 15G6

### Fault symptoms:

Non-concentric engine running  
Noises in the engine region

### Cause:

Low-quality valve springs have been installed.

### Remedy:

Replace valve spring(s).

### Action validity period:

from 2018/07/19 until 2023/10/31

### Concerns the following vehicles:

Model	Model year	Engine
ARTEON (3H_)	2018	2.0 TDI diesel engine
GOLF VII (BQ1)	2018	2.0 TDI diesel engine
GOLF VII Variant (BV5)	2018	2.0 TDI diesel engine
PASSAT (3G_)	2018	2.0 TDI diesel engine
SHARAN (7N_)	2018	2.0 TDI diesel engine
T-ROC (A11)	2018	2.0 TDI diesel engine
TIGUAN (AD1)	2018	2.0 TDI diesel engine
TIGUAN ALLSPACE (BW2)	2018	2.0 TDI diesel engine

### Required spare parts:

Spare part	Quantity	Part number
Sealing ring(s)	4 times	059 130 519
Seal(s)	1 times	04L 253 115 A
	1 times	1K0 253 115 AE
Hexagonal socket screw(s)	1 times	N 106 469 01
Internal TORX screw	18 times	N 101 562 07
O ring(s)	4 times	WHT 000 884
	4 times	WHT 006 497
Clamp(s)	1 times	04L 253 725 B
	1 times	1K0 253 725
Hexagonal nut(s)	1 times	038 109 454 A
Hexagon head screw(s)	1 times	N 106 044 03
Tensioning screw(s)	1 times	N 910 125 02
Valve spring(s)	16 times	059 109 633 N
Cylinder screws(s)	4 times	N 910 488 04
	2 times	WHT 005 478
	1 times	N 911 083 01

Job should be documented in service booklet when this job has already been performed.

This job can only be carried out by an authorized garage.

The authorized dealer will check whether the vehicle is concerned.

## Required Labour Times


Labor	Scheduled times
Replace valve spring(s).	7,60h

## Procedure

Replace valve spring(s). [1]  
(see figure)

Please contact our technical support for further details.

Figure

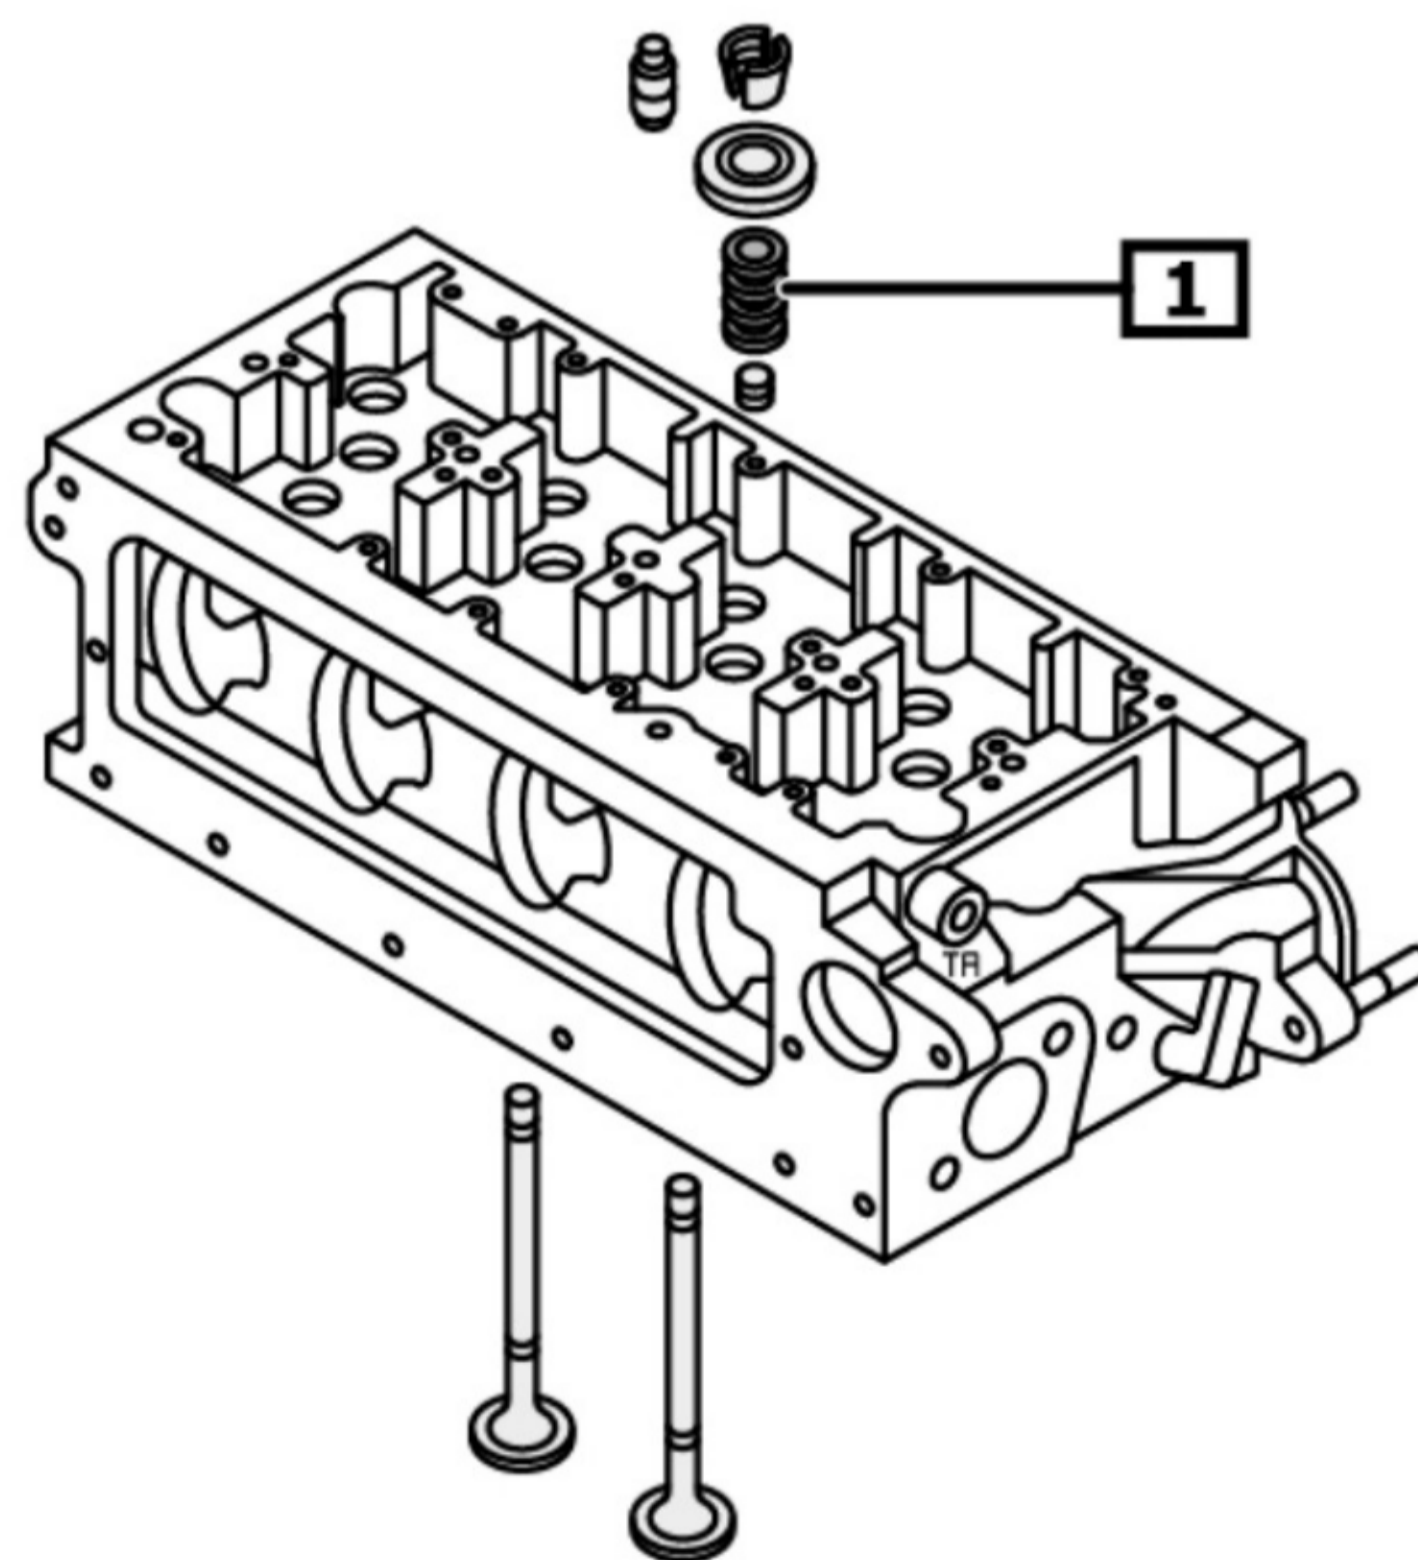

1 Valve spring(s)

[Download / Print Document](#)